

Reflective Cracking Outdoor Phase 1 Comprehensive Report Part B – Test Report
Appendix B: Distress Map




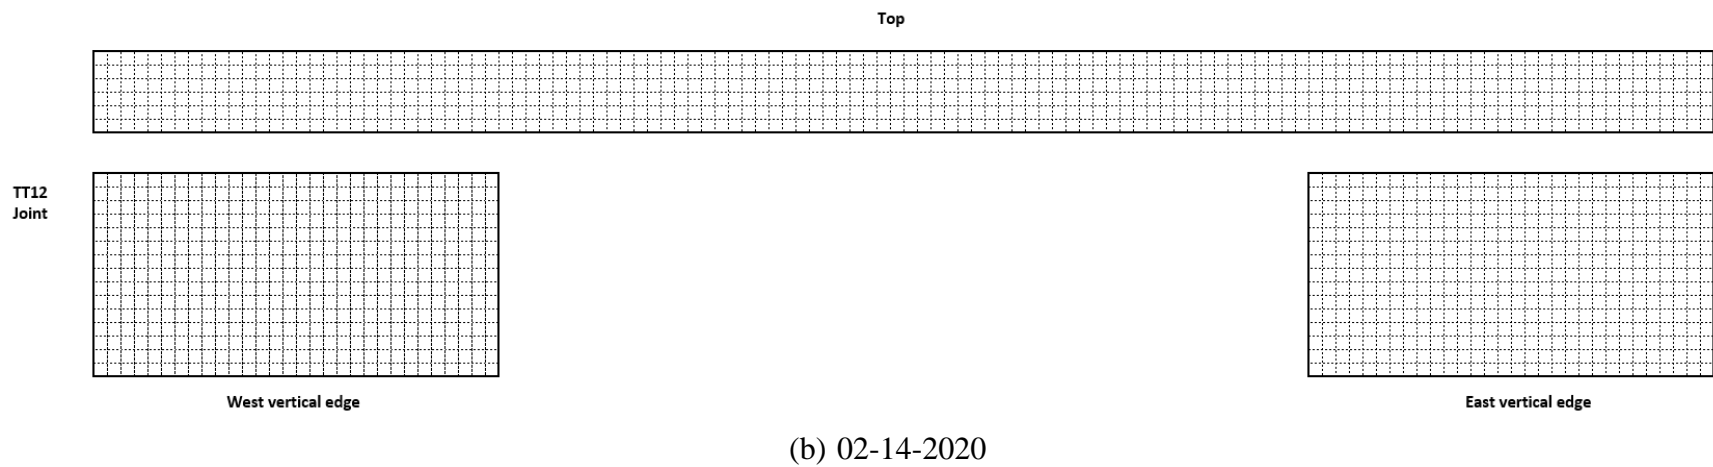


Figure B.1: Joint#1 (TT12)

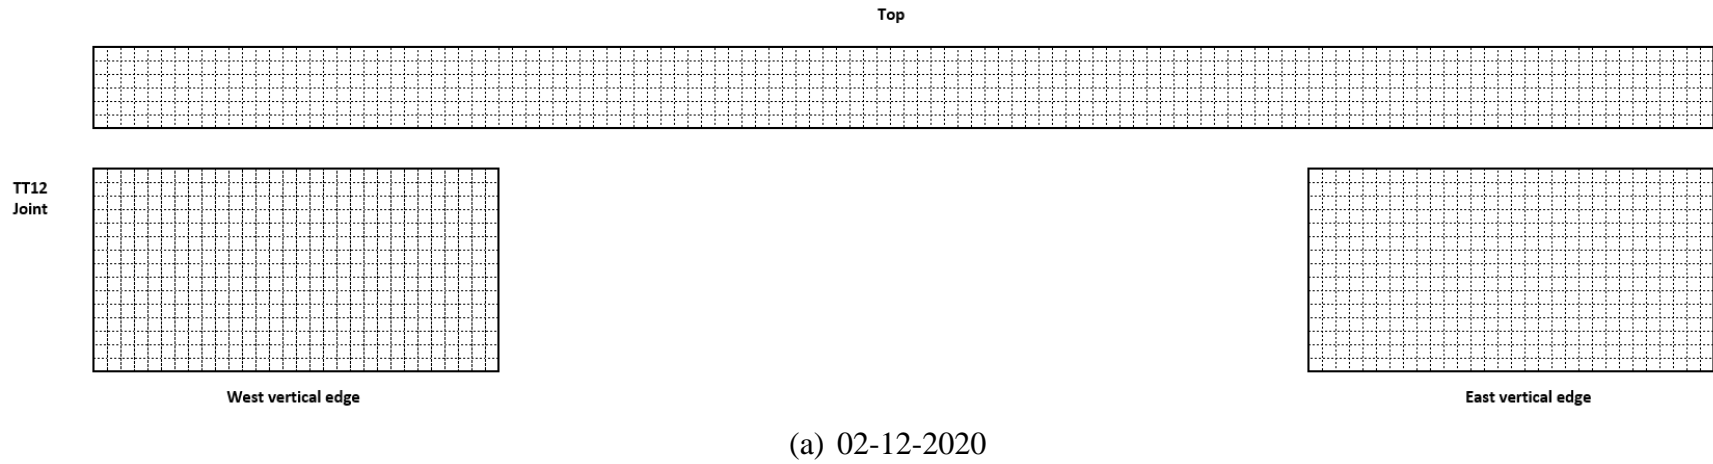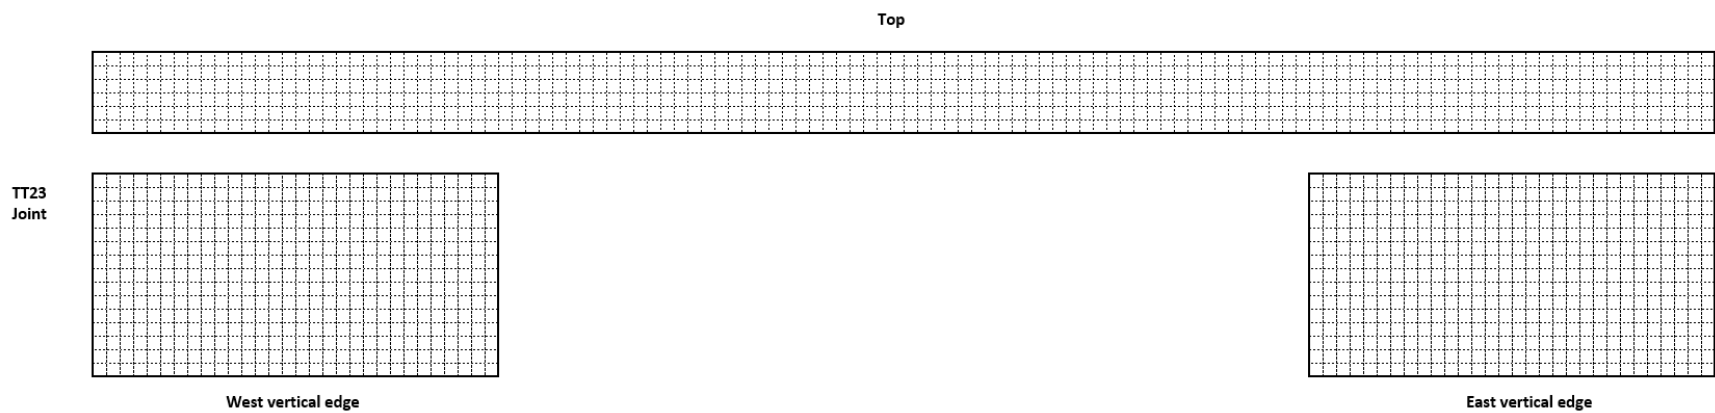


(a) 02-12-2020

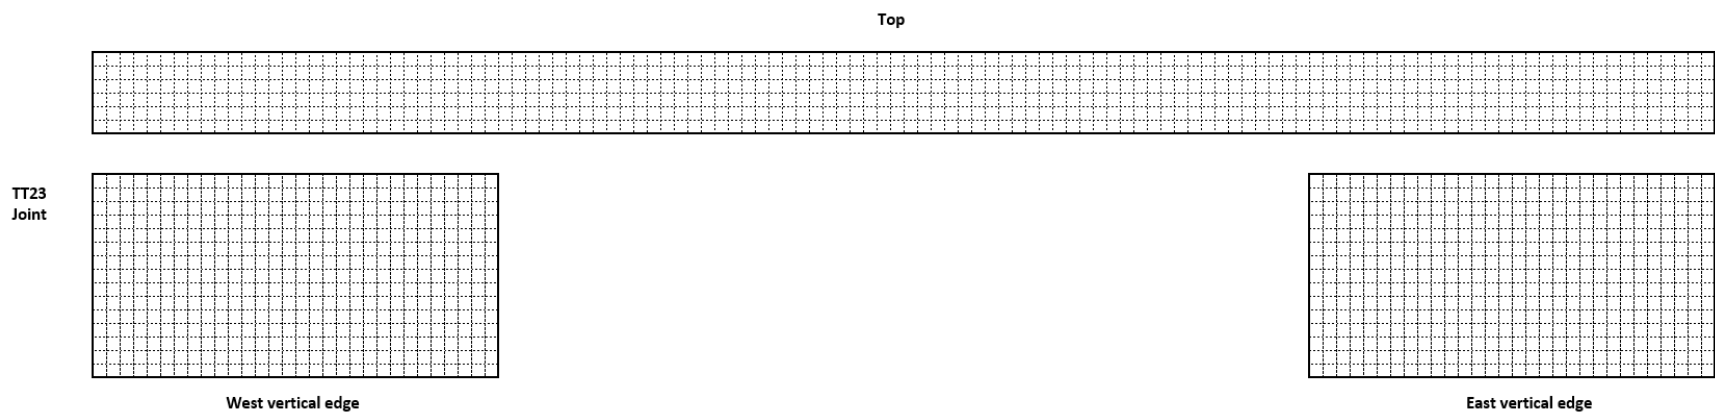


(b) 02-14-2020

Figure B.2: Joint#2 (TT23)

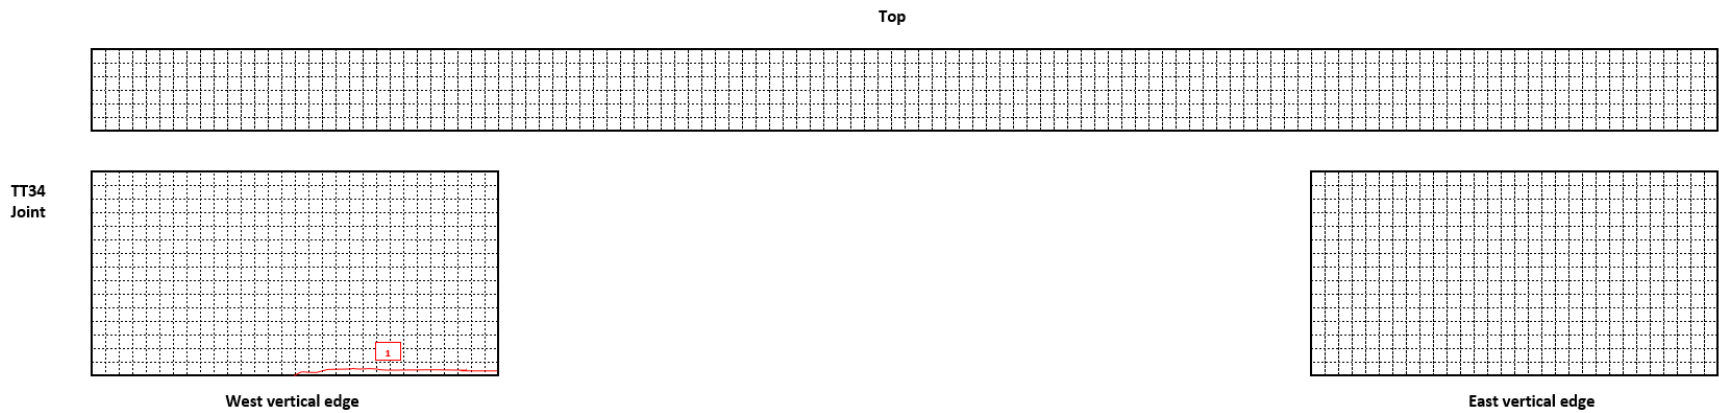

(a) 02-12-2020

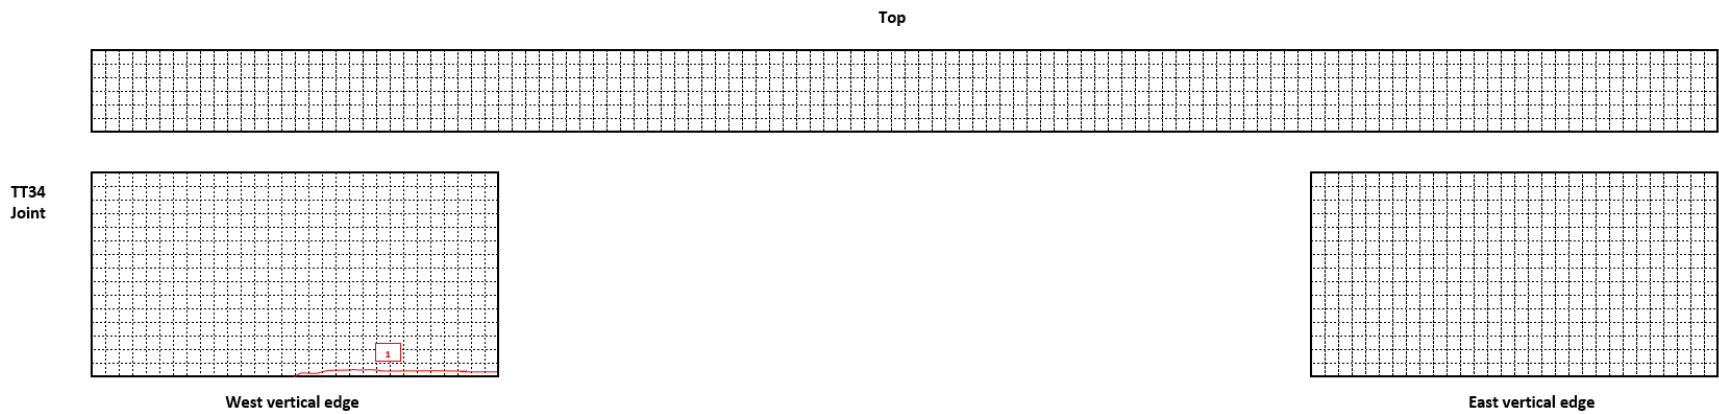

(b) 02-14-2020


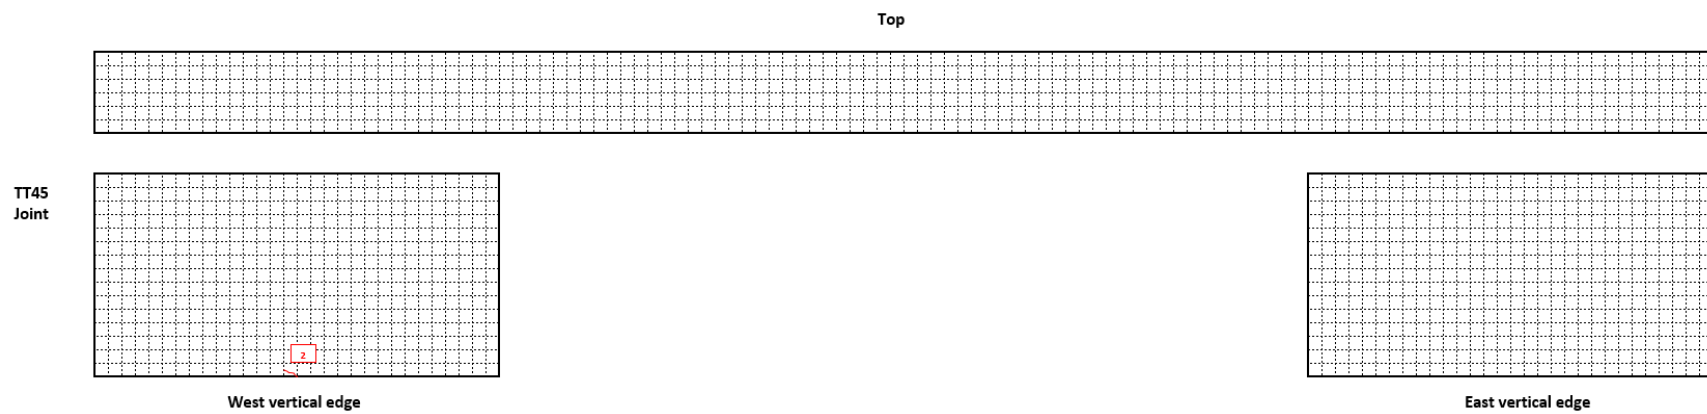
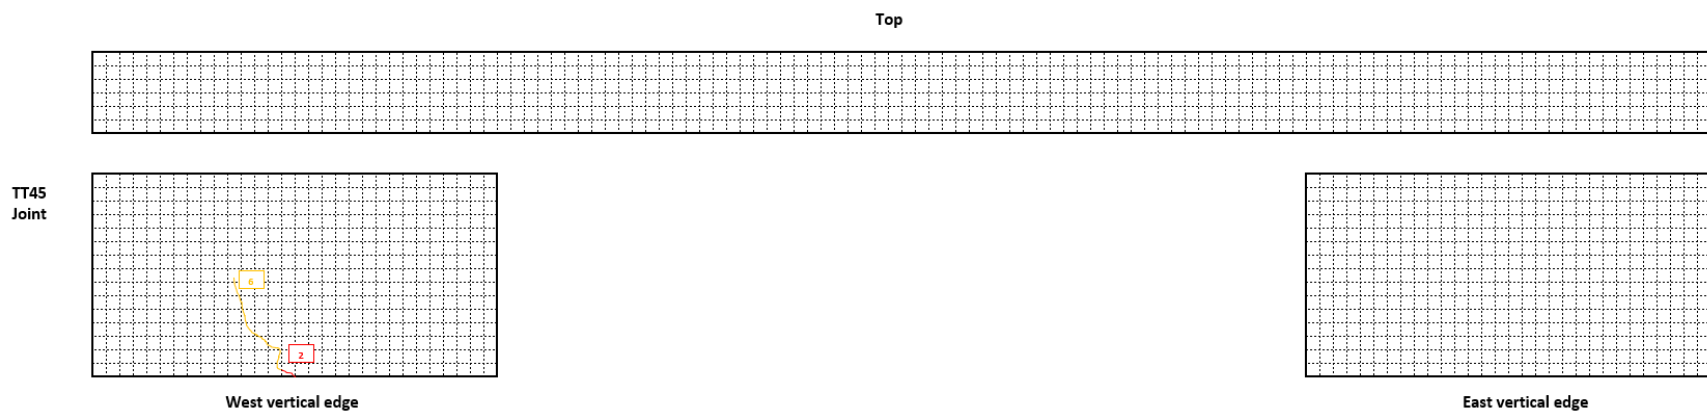
COLOR	DATE	INITIALS	TOTAL CYCLES
	12-02-20		1116

Figure B.3: Joint#3 (TT34)



(a) 02-12-2020



(b) 02-14-2020




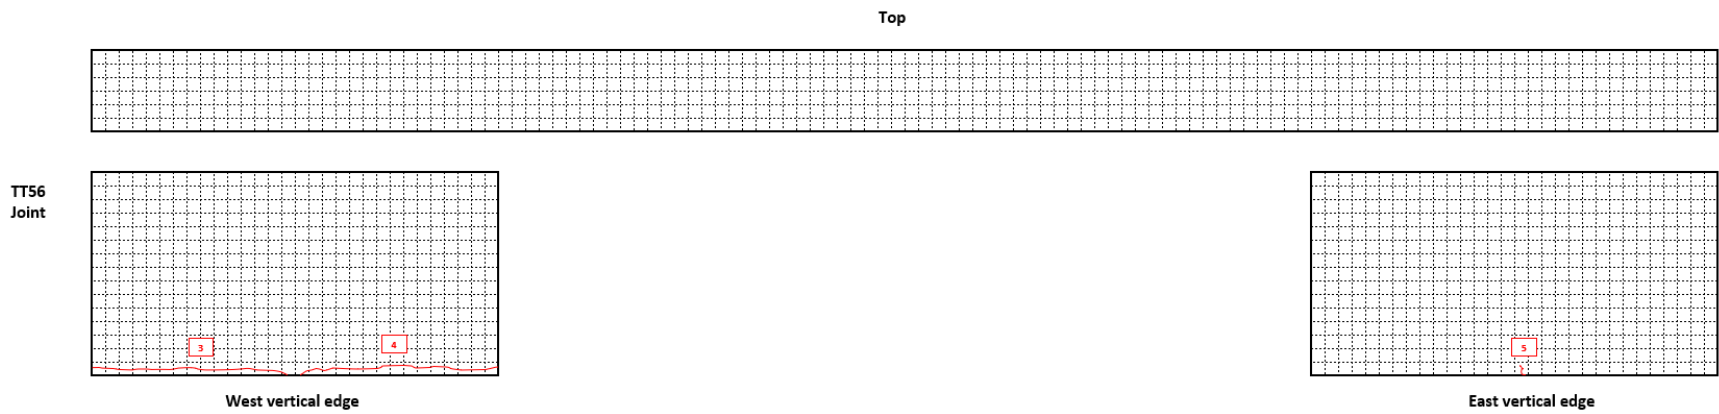
COLOR	DATE	INITIALS	TOTAL CYCLES
	12-02-20		1116
	14-02-20		2356

Figure B.4: Joint#4 (TT45)



(a) 02-12-2020

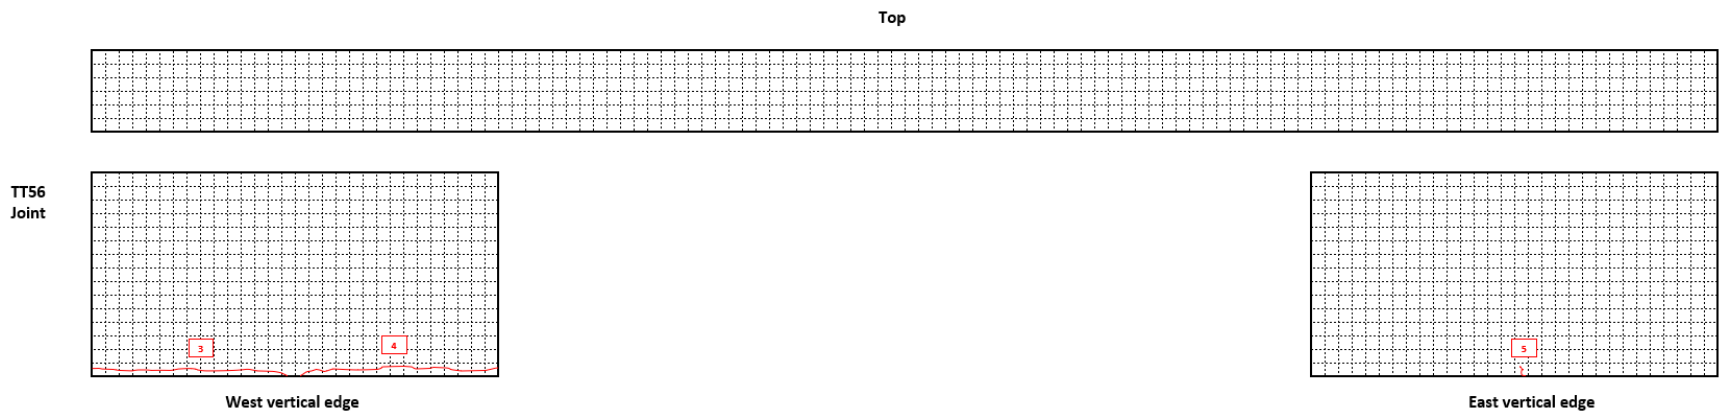

(b) 02-14-2020


COLOR	DATE	INITIALS	TOTAL CYCLES
	12-02-20		1116

Figure B.5: Joint#5 (TT56)

Table B.1: Written Log (02-14-2020)

DATE	TOTAL CYCLES	DISTRESS							NOTES
		DESCRIPTION	NO.	LOCATION					
				X AXIS (in.)		Y AXIS (in.)		Section	
				INITIAL	END	INITIAL	END		
11-02-20	496								No new crack was observed.
12-02-20	1116	Bottom-up crack	1	3	6	0	0.1	TT34 joint, West vertical edge	
12-02-20	1116	Bottom-up crack	2	2.8	3	0.1	0	TT45 joint, West vertical edge	
12-02-20	1116	Bottom-up crack	3	0	2.9	0.1	0	TT56 joint, West vertical edge	
12-02-20	1116	Bottom-up crack	4	3.1	6	0	0.1	TT56 joint, West vertical edge	
12-02-20	1116	Bottom-up crack	5	2.9	3	0.1	0	TT56 joint, East vertical edge	
13-02-20	1736								No new crack was observed.
14-02-20	2356	Bottom-up crack	6	2.1	2.8	1.4	0.1	TT45 joint, West vertical edge	
18-02-20	2976								No new crack was observed.